

(b) (9)

Osage County, OK

PRESENT CONDITION:

TD 1521'
10" casing set at 64'
6-5/8" casing set at 1242'
5-3/16" slotted liner set at 1227'-1521'

PLUGGING PROCEDURE:

- (1) Shoot 4 holes at 1025'±.
- (2) Place cement plug 1040' - 800'± (approx 25 sxs) & squeeze 25 sacks into perforations at 1025'.
- (3) Fill casing with gelled mud 800' to 200'±.
- (4) Shoot 4 holes at ²¹⁵200' and circulate cement outside 6-5/8" casing ²¹⁵200' to surface. Fill 6-5/8" casing with cement 200' to surface.
- (5) Cut off casing strings 3' below ground level and weld steel plate on top.
- (6) Clean up location and restore surface.

AMH/maa

 
04-14-89

RECEIVED

APR 26 1989

EPA 6W-S
REGION VI

APPROVED

UIC/EPA
APR 17 1989